




Panasonic KX-NS700 Timeout Forward an ICD to a Custom Service Menu Telquest Tech Support

Add a Special Option 1. Click here... The Special Option eliminates the need for a caller to dial 9 when in a Personal Custom Service Menu

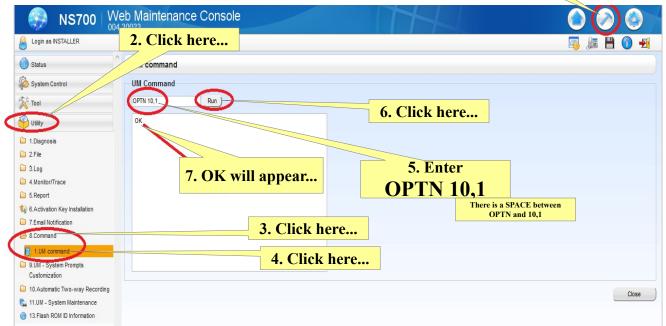

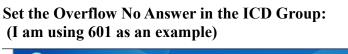


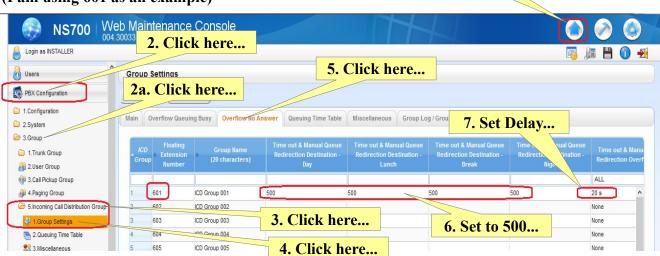

1. Click here...


Page 2

Verify that you have an ICD Group Mailbox. (I am using 601 as an example)

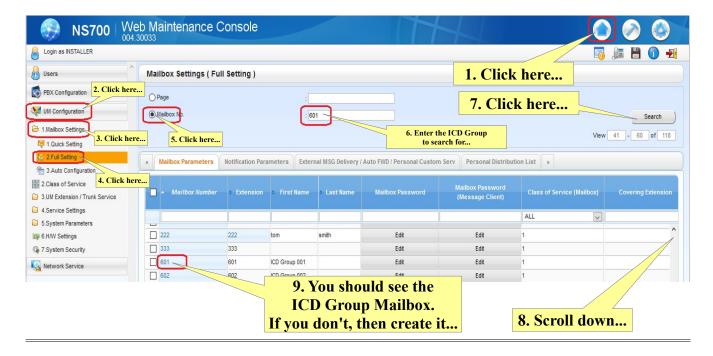

You are still on the same page...


Set the Personal Custom Service Menu for the ICD Group Mailbox...

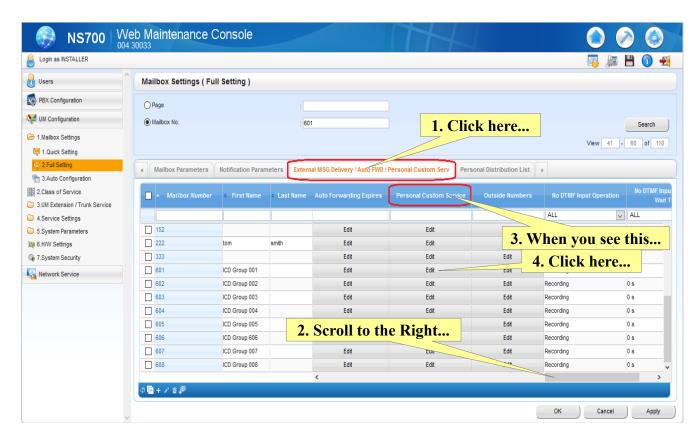

Page 3


This will appear...

Note: The caller does NQT need to dial 9. The Special Option sets it for No DTMF Transfer.

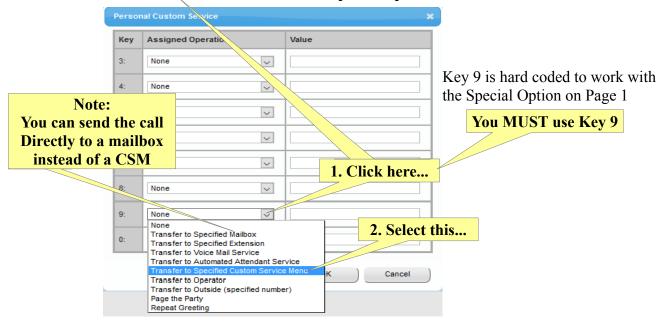

If you chose "Transfer to Specified Mailbox" then you must enter a valid Mailbox number. Note: You CANNOT use the same ICD Group Mailbox that brought you here. In this example, ICD Group Mailbox 601 brought us here. So you cannot send it here. If you do, you will get an Endless Loop Condition that repeats the Greeting in Mailbox 601.

If you chose "Transfer to Specified Custom Service Menu" then you must enter a valid/working Custom Service Number like 1, 2, 3 etc...

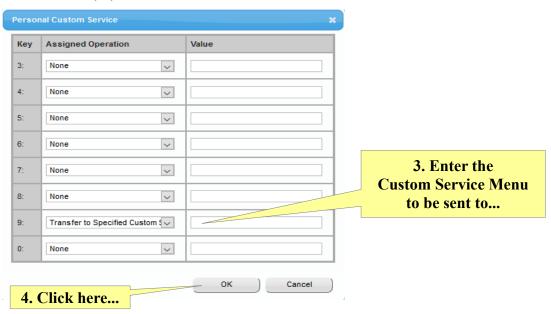

Theory of operation: (Using ICD Group 601 in this example)

A call comes in on a CO, Sip or PRI Line.

It is sent to ICD Group 601.

If the call is not answered by the ICD's Timeout value, it is sent to Floating Number 500. Floating Number 500 is the Voice Mail System. / UM (Unified Message)

Floating Number 500 will send the call to Mailbox 601.

Mailbox 601 will play a short Greeting, that you can change, and then send the call to the Custom Service Menu specified in its Personal Custom Service Menu.